

# Manhole Inspection Summary

Manhole # S11C\_\_015MH

Printed On: 6/24/2010

Page 1 of 3

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **11C** Node: **015** Status: **Found**

Insp Date: **3/21/08 12:14 PM**

Incomplete Comments

Crew: **MG,CB**  
Inspector: **Grace**  
Firm: **URS**

**Location** Address: **EDMONDSON AVE**

Cross Street: **UPPER ELLICOTT DRIVE**

**Manhole** Type: **Inline** Location: **Easement / Right of Way**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Heavy Rain**

Subject To Ponding: **None**

Comments

**Cover** Shape: **Circular** Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **27** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick** ☐ Parged Height: **24** (in.)

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel** Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☒ **Roots** ☐ Wall

**Barrel** Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench** ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris


**Steps** Count: **8** Missing: **0** ☒ **Corroded**

**Surcharge** ☒ **Evidence Of Surcharge** Depth: **11** (ft.) ☐ Active Surcharge Present

Location View



Top View

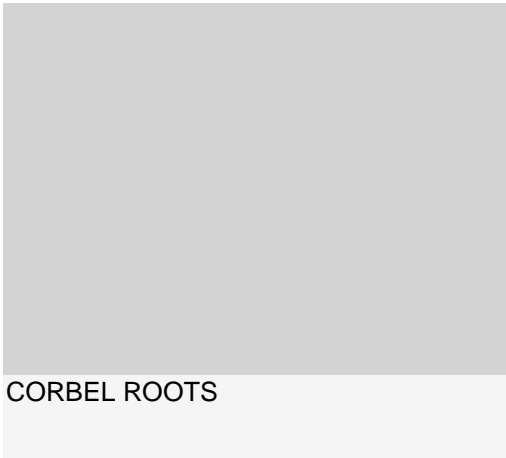


EVIDENCE OF SURCHARGE



GRADE ADJUSTMENT



Defect 1

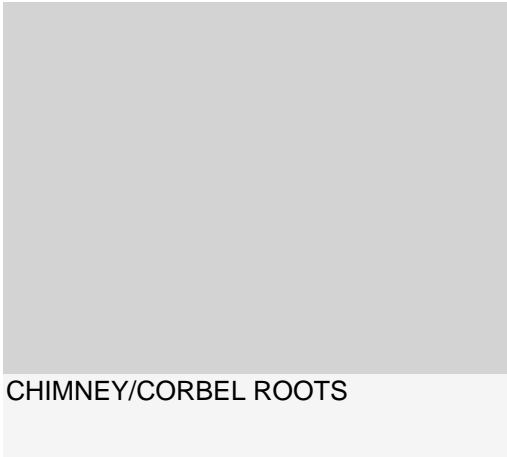

## Manhole Inspection Summary

Manhole # S11C\_\_015MH

Printed On: 6/24/2010

Page 3 of 3

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **15.20** (ft.) Flow Characteristics: **Turbulent**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 7 O'Clock

7 O'Clock Inflow

Drop In @ 7 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.40** (ft.) Flow Characteristics: **Turbulent**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Cracked**

Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **13.20** (ft.)

Inv Depth: **14.20** (ft.)

Drop Condition: **Clogged**

Connects To: **Manhole**

☐ Possible Illicit Connection